


# AMENDMENT FOR PBX SERIES OPERATION MANUAL

- Page No.9: Correct specifications table for PBX series

Revised Contents

| MODEL | PBX-55022        |                                      |                                          | PBX-55011                                |                                          | PBX-65011               |
|-------|------------------|--------------------------------------|------------------------------------------|------------------------------------------|------------------------------------------|-------------------------|
| TYPE  | BAA              | BAB/BAE                              | BAD                                      | BAC                                      | BAB                                      | BAC                     |
| MOTOR | Output [W]       | 400                                  |                                          |                                          |                                          |                         |
|       | Consumption [W]  | 680                                  |                                          | 690                                      |                                          | 750                     |
|       | Revolution [rpm] | 2,800                                |                                          |                                          |                                          |                         |
|       | Power Cord       | VCT<br>3Cx1.25mm <sup>2</sup><br>x6m | H07RN-F<br>3Gx1.0mm <sup>2</sup><br>x10m | H07RN-F<br>3Gx1.5mm <sup>2</sup><br>x10m | H07RN-F<br>3Gx1.5mm <sup>2</sup><br>x20m | STOW<br>3/16AWG<br>x10m |

- Page No.12-13: Add 67 parts

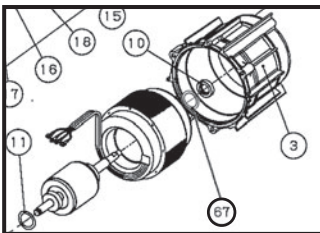

| No. | PARTS CODE | PARTS NAME     | QTY |
|-----|------------|----------------|-----|
| 67  | 0430761    | Bearing Washer | 1   |

- Page No.15: Correct Parts Code Number of No. 21

Revised Contents



| No. | PARTS CODE | PARTS NAME                                                                                           | QTY |
|-----|------------|------------------------------------------------------------------------------------------------------|-----|
| 21  | 0438211    | Power Cord with A<br>(with ground pin)type plug<br>VCT 3x2.0mm <sup>2</sup> x15m<br>(PBX7-65011-BAB) | 1   |

for PBX7-55022

- Page No.7: Add text

- After stopping the operation, high electric voltage should remain in the capacitor under head cover. Maintenance or repairing works must be restricted by skilled staff.  
Improper works may cause serious injury by strong electric shock. Please be careful for handling.

- Page No.14-15: Add 67, 68, 69 and some parts

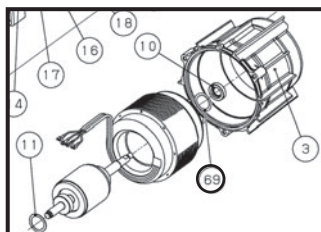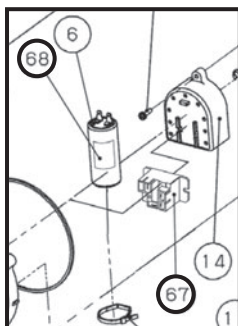

| No. | PARTS CODE | PARTS NAME                        | QTY |
|-----|------------|-----------------------------------|-----|
| 67  | 0430758    | Power Relay (PBX7-55022)          | 1   |
| 68  | 0430759    | Caution Label (PBX7-55022)        | 1   |
| 69  | 0430761    | Bearing Washer                    | 1   |
|     | 0430760    | Scotch lok Connector (PBX7-55022) | 2   |
|     | 0438212    | Lead Wire Assy A (PBX7-55022)     | 1   |
|     | 0438213    | Lead Wire Assy B (PBX7-55022)     | 1   |
|     | 0438214    | Lead Wire Assy C (PBX7-55022)     | 1   |
|     | 0438215    | Lead Wire Assy D (PBX7-55022)     | 1   |
|     | 0438216    | Lead Wire Assy E (PBX7-55022)     | 1   |